

Test Report

Report No.: WTG19G01002267P

Date: 2019/01/10

Page: 1 of 3

Applicant: TRIECO (HUIZHOU) CO., LTD

Address: 4FL |Building# 3|No.38 Shihua RD West | Huiyang | Huizhou

Sample information

Sample Name: IP54 LED linear trunking light

Sample Model: T031560BN80NxF-W001

Amount of sample: 1pcs

Sample Received Date: 2019/01/10

Testing Period: 2019/01/10

Test Requested: IPX4 test

Test Method: According to IEC 60598-1-2017 and the clients' requirement

Test Result: Please refer to following pages

Tested by

Weiming Luo

Weiming Luo

Checked by

Toby Zhang

Toby Zhang

Signed for and on behalf of HCT

Joseph Li

Joseph Li
Manager

Test Report

Report No.: WTG19G01002267P

Date: 2019/01/10

Page: 2 of 3

Test item: IPX4 test

(1) Detection equipment and instruments

Instrument name	Model	Serial No.	Equipment manufacturers	Valid Date to
Oscillating Tube Tester	BL1200	HCT-SE169	VINOPS	2019/10/19

(2) Environmental Conditions:

Temperature: 20℃ Humidity: 65%RH

(3) Tested Sample: Sample 001

(4) Test Basis: IEC 60598-1-2017

(5) The test performed in accordance to the criteria listed above, and under the conditions as below:

- 1) Power on the sample 0.5~1h, to normal working temperature
- 2) Water flow rate: 3.5L/min
- 3) The rotation speed of the turntable: 1rpm
- 4) The tube is caused to oscillate through an angle of 180° on either side of the vertical
- 5) Radius of the tube: 800mm
- 6) Test duration: Power on test 10 min; Power off test 10 min

(6) Test results

Sample No.	Sample name	Test Results
001	IP54 LED linear trunking light	The function was normal, and no water entered into the sample, the sample passed the IPX4 test.

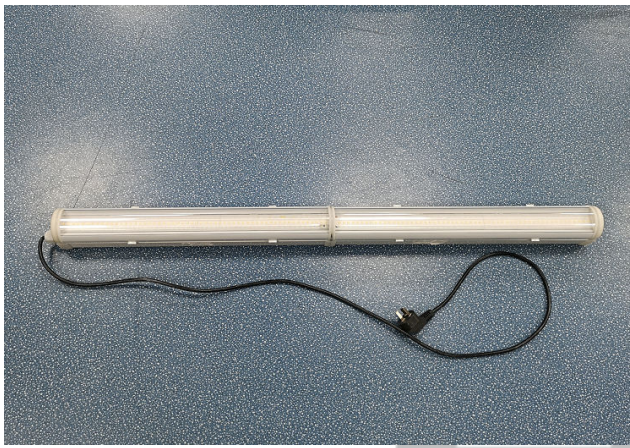
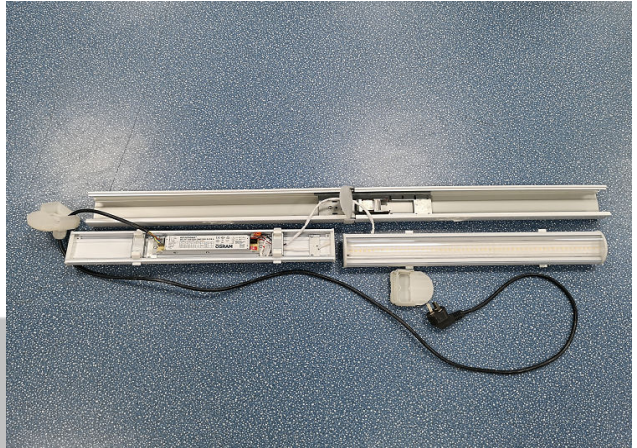
Test Report

Report No.: WTG19G01002267P

Date: 2019/01/10

Page: 3 of 3

(7) Test photos

	
Before test	After test
	
In test	/

*** End***

This report will go into effect with HCT stamp. This report could not be revised. This report is only responsible for the test result of submitted samples. Without written authorization, any copy of this report for propaganda is invalid.