

Test Report

Report No.: HCT18LR-1741R

Date: 2018/12/29

Page: 1 of 4

Applicant: TRIECO (HUIZHOU) CO., LTD

Address: 4th FL, 3rd Building, Xinghua Industry park, No. 38 Shihua Road West, Dayawan, Huizhou

Sample information

Sample Name:	Module
Sample Model:	/
Amount of sample:	3pcs
Sample Received Date:	2018/12/20
Testing Period:	2018/12/20~2018/12/27

Test Requested: Salt spray test

Test Method: According to GB/T 2423.17-2008 and the clients' requirement

Test Result: Please refer to following pages

Tested by

Checked by

Signed for and on behalf of HCT

Weiming Luo

Toby Zhang

Joseph Li
Manager

Test Report

Report No.: HCT18LR-1741R

Date: 2018/12/29

Page: 2 of 4

Test item: Salt spray test

(1) Detection equipment and instruments

Instrument name	Model	Serial No.	Equipment manufacturers	Valid Date to
Salt spray test chamber	W-CS90-Z	HCT-SE164	WEWON	2019/10/19

(2) Environmental Conditions:

Temperature: 20℃ Humidity: 65%RH

(3) Tested Sample: Samples 001~003

(4) Test Basis: GB/T 2423.17-2008

(5) The test performed in accordance to the criteria listed above, and under the conditions as below:

- 1) Temperature of the chamber: 35℃
- 2) Temperature of the saturation tower: 47℃
- 3) Liquor: 5%NaCl (by weight)
- 4) pH value of the liquor: 6.7 (35℃)
- 5) Volume of salt solution collected: 1~2mL/80cm²/h
- 6) Test duration: 168h

(6) Test results

Sample No.	Sample name	Test Results
001~003	Module	Corrosion was found on the surface of the samples.


Test Report

Report No.: HCT18LR-1741R

Date: 2018/12/29

Page: 3 of 4

(7) Test photos

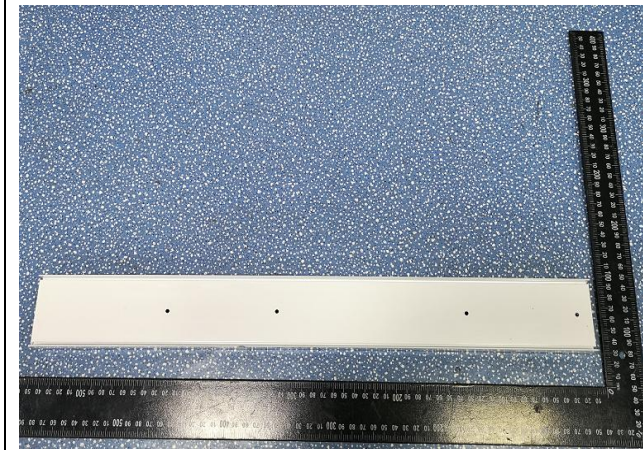


Before test 001



After test 001



After test 001 A

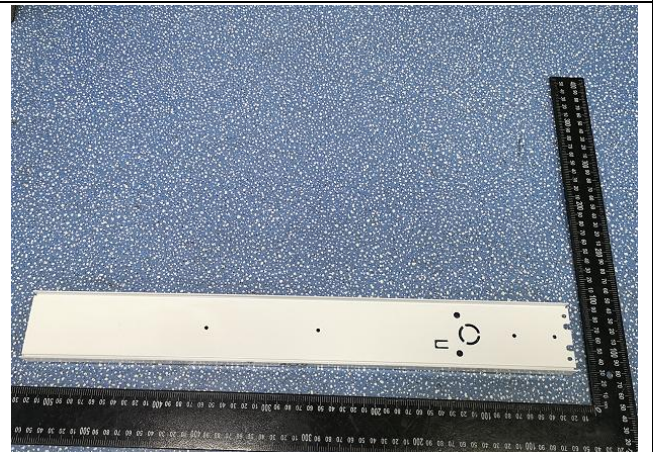

Before test 002



After test 002




After test 002 A

Test Report

Report No.: HCT18LR-1741R

Date: 2018/12/29

Page: 4 of 4

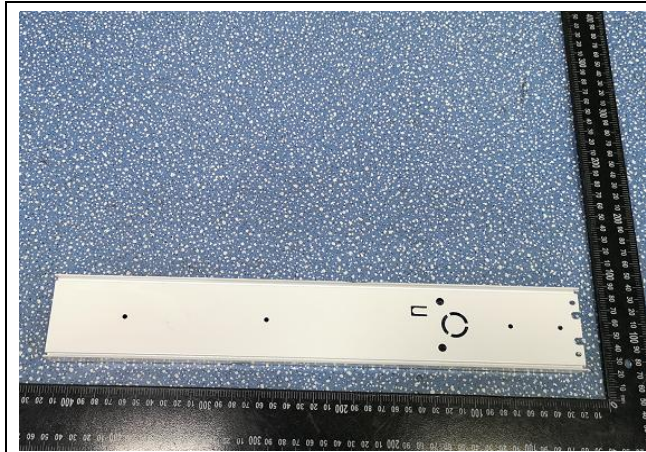

Before test 003



After test 003



After test 003 A



In test

*** End***

This report will go into effect with HCT stamp. This report could not be revised. This report is only responsible for the test result of submitted samples. Without written authorization, any copy of this report for propaganda is invalid.